

	FROM					TO			
Control unit	Diagnosis address	Original SW code	HW version	SW version	New SW code	New SW version	Symptoms	FLASH WITH	AM
OCU HIGH	0075	5WA 035 284 A	H12	0067	5WA 035 284 C	0142	Required for the stability of online services, other software combinations not guaranteed/tested by the platform Important E-Call changes implemented Enable ORU in MIB3 OI E-Call error correction	DoIP	3629
Sound system	0047	5H0 035 456 A	H05	4315	5H0 035 456 A	4319	Annoying noise from speakers		
				4316					
			H06	4315					
				4316					
MIB OI	005F	5FA 035 862 B 5FA 035 862 C	H56	1664, 1666, 1668, 1672	5FA 035 862 H 5FA 035 862 J	1896	Stability and collision system New features: Wireless Android Auto, ORU, PSO includes MIB (ATN) 2000 tickets resolved compared to VRC Automatic Bluetooth connection WLAN Carplay disconnection Black Carplay screen Black RVC image screen Magenta screen after RVC Green RVC bar Upper frame areas not available after reverse DTC beep in Park assist ASW constant beep Stationary heater menu in HMI Reset to factory settings--> Tile menus are not reset All tile menus appear black Navi tile menu remains black (if Navi is not encrypted) The navigation database is not updated sporadically The system restarts	USB	SD-Creator 5FA 919 360 S
RVC	006C	5WA 980 556 A	H15	0193	5WA 980 556 C	0314	Black screens Reduced activation time	CAN	3629
			H17						
			H18						
			H20						
			H21						
		5WA 980 556 B	H15	0254					
			H17						
			H18						
			H20						
			H21						
			H26						
GATEWAY	0019	5WA 907 530 C	752	7070	5WA 907 530 N	7087	Required for the stability of online services, other software combinations not guaranteed/tested by the platform		3627
				7078					
		5WA 907 530 E		7072					
				7075					
		5WA 907 530 J		7082					

BCM	0009			7083		0159	Required for the stability of online services, other software combinations not guaranteed/tested by the platform		
				7084					
		5WA 937 086 P	016	0133	5WA 937 086 E				
		5WA 937 086 Q		0134 0136	5WA 937 086 F				
		5WA 937 086 R		0137	5WA 937 086 G				
AIRBAG	0015	1EA 959 655 AA	009	0164	1EA 959 655 CH	0166	The airbag unit locks Various DTCs/qualified internal errors (0xFF1B01, 0xEA6400, 0xFF0807...) ECU defective after deleting error buffer on undervoltage Airbag warning lamp. Light on without DTC Airbag warning lamp. Light on without DTC AWL on without DTC After a collision there is no entry in the fault memory, the collision is not detected and it is not activated FSP warning lamp without ON/OFF switch		3629
		1EA 959 655 AC			1EA 959 655 CK				
		1EA 959 655 BH		0037	1EA 959 655 CG				
		1EA 959 655 BJ			1EA 959 655 CH				
		1EA 959 655 BL			1EA 959 655 CK				
		1EA 959 655 BB		0036	1EA 959 655 CG				
		1EA 959 655 BC			1EA 959 655 CH				
		1EA 959 655 BE			1EA 959 655 CK				